

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS - 1963 - A

AD A 121390

APPROVED FOR PUBLIC RELEASE DISTRIBUTION UNLIMITED

PTPT Report No.: 82-10 AFPEA Project No.: 81-P7-27

TED P. SMITH
Mechanical Engineer
DWIGHT SHEETER
Mechanical Engineering Technician

AUTOVON 787-7445 Commercial (513) 257-7445

INVESTIGATION OF MIL-B-131 BARRIER MATERIAL HEAT SEALS



HQ AFALD/PTP
AIR FORCE PACKAGING EVALUATION AGENCY
WRIGHT-PATTERSON AFB, OHIO 45433

OCTOBER 1982

82 11 10 012

NOTICE

When government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related government procurement operation, the United States Government thereby incurs no responsibility whatsoever; and the fact that the government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any pateried invention that may in any way be related thereto. This report is not to be used in whole or in part for advertising or sales purposes.

ABSTRACT

This study was performed to evaluate the severity of the 50 oz. dead weight test specified in MIL-P-116 for MIL-B-131 barrier material heat seals. Many of the Air Logistics Centers were reporting a high incidence of heat seal rejections. The study indicated the current test requirement and procedure to be realistic and attainable provided that proper techniques for equipment cleaning and set-up are followed. Also careful attention to temperature and pressure settings is necessary.

Acce	ssion For
NTIS	GRA&I
DIIC	TAB 🕋
Uran	nounced \Box
Just	ification
Ву	
Dist	ribution/
Ava	ilability Codes
	Avail and/or
Dist	Special
	1 1
M	
4-4-	
	INC.

TED P. SMITH & DWIGHT SHEETER	PUBLICATION DATE:
Materials Engineering Division AF Packaging Evaluation Agency	110x 82
MATTHEW A. VENETOS Chief, Materials Engineering Division AF Packaging Evaluation Agency	APPROVED BY: RALPH ZYNDA Actg Director, Air Force Paraging Evaluation Agency

INTRODUCTION

This investigation was initiated because of the difficulties many air force packaging activities were reporting in producing heat sealed seams on flexible packages that would meet the seal strength test specified in MIL-P-116, Preservation, Methods Of, for MIL-B-131 Barrier Material, Watervaporproof, Flexible, Heat Sealable. Some of the Air Logistics Centers (ALCs) felt that the 50 oz. seam strength test of MIL-P-116 was too severe and should be modified to a lower value. As an interim measure permission was granted by AFALD/PTP to reduce the 50 oz. weight requirement of the MIL-P-116 test to the 32 oz. weight specified in MIL-S-4461, Sealing Machines, Heat: Hot Jaw and Continuous, until a thorough evaluation could be performed.

TEST SAMPLES

Twelve sets of test samples consisting of MIL-B-131 barrier materials from three manufacturers were obtained from the Air Logistics Centers. Each test sample was assigned an identification number which relates to a specific manufacturer, lot number and the ALC from which the material was received (Table I).

SAMPLING

The roll/sheet stock was sampled according to the sampling pattern position number 1 prescribed in MIL-B-131 (Figure 1). The bags were sampled randomly according to MIL-B-117, Bags, Sleeves and Tubing - Interior Packaging.

QUALITY CONFORMANCE

The evaluation was performed using a 4.0% AQL according to MIL-B-117.

TEST EQUIPMENT

- 1. Doboy Continuous Heat Sealer, Model HS-B (Figure 2).
- 2. Sentinel Heat Sealer, Model 12-12ASC (Figure 3).
- 3. Electric Timer, Labline, Inc. Lab-Chron 1400 (Figure 4).
- 4. Seam Strength Test Device (Two clamping jaws suspended from a stationary beam. Lower jaw weight 50 oz.). (Figure 5).

TEST PROCEDURE

The test procedure used for the heat sealed seam strength test was Method 2024 of Federal Test Method Standard 101. The test specimens were conditioned at 72° F and 50% RH for a minimum of 24 hours. The seam strength tests were performed in the same environment.

Method 2024 specifies hanging a one-inch sample between the lower just a mounted to a stationary beam and the lower just weighted to

50 oz. total weight (includes jaw weight). The sample is clamped perpendicular in the upper jaw. The weighted lower jaw is then gently suspended on the sample. The weight is suspended for 5 minutes with no seam separation allowed during the last 3 minutes. A black felt tip mark was made across the seam to aid in visual inspection of seam separation.

In addition to the standard test procedure prescribed for determination of heat seal strength a special test procedure was developed for this study to determine the ultimate strength of the heat seal seam. The seam strength test device (Figure 5) was modified to hang a metal can from the lower jaw. Lead shot was added to the can until the total weight was 50 oz. The weighted jaw was suspended from the sample for 5 minutes. An additional 5 oz. of lead shot was added to the can and suspended for 3 more minutes. Each time the sample survived the addition of a weight increment another 5 oz. of shot was added to the can and suspended for an additional 3 minutes. The procedure was continued until the sample failed.

The test used by the Department of the Navy was from MIL-B-131 (para. 4.6.2.2.2 - Test at Room Temperature). This test is identical to Method 2024 above except the heat seals are produced on a bar sealer and a 56 oz. weight is used.

TEST RESULTS

Initial experiments were done using both the Sentinel Heat Sealer and the Doboy Heat Sealer to determine the optimum sealing temperatures, pressures and dwell times. This preliminary testing indicated that acceptable seals could readily be made with the Sentinel, but the Doboy seals were more difficult to produce, being more sensitive to operating conditions.

Since the Doboy sealer was an older machine with significant wear, it was necessary to disassemble, thoroughly clean and reassemble the sealer with careful attention being given to proper alignment. Subsequent experiments showed that it was necessary to set the heating bars wide enough apart (approximately 1/8 inch) to avoid drag on the barrier material. Also, the compression wheels were set exactly parallel to each other and the degree of compression was varied by adjusting the spring tension with a trial and error procedure until optimum seals were obtained, usually at the higher pressure settings.

Table II shows the results of tests run on the Doboy at various sealing temperatures. The results indicate that the optimum sealing temperature for this machine is 250°C. Temperatures of 275°C and above produced acceptable seals but resulted in physical damage to the seal area.

The results of the basic quality control tests run on the various materials from the Afr Logistics Centers are presented in Table III. These results indicate that all materials passed except for specimens A, D and J. Materials A and J exceeded by only one the number of defects permitted to pass but unfortunately there was not enough material for a retest; however, there was sufficient material to retest specimen D. Table III also shows the results of the retest of material D, as well as material E, which was retested as a control. Both materials were tested on the Doboy and the Sentinel heat sealers. The results in Table III show that all material D specimens passed on retest and only one

seal failure occurred with material E.

The six heat sealed specimens tested in Table IV were made with the Doboy Heat Sealer using the same settings used for the specimen in Table III. Table IV provides the total weight suspended on each sample when it failed.

Table V provides the results of tests run by the Naval Air Development Center, the OPR for MIL-B-131. These tests were run using the test prescribed in MIL-B-131 using a 56 oz. weight.

CONCLUSIONS

The 50 oz. heat seal test specified for MIL-B-131 barrier materials in MIL-P-116 is a realistic quality control test. Appropriate attention to details in producing the heat seals is necessary because only seals made at the proper temperature and pressure can be expected to pass the test.

Our investigation indicated that heat seals which fail the test are primarily the fault of improper condition and adjustment of the heat sealing equipment. Proper cleaning, accurate alignment and careful adjustment of sealing temperature and pressure (250°C and high pressure for the Doboy used in this project) are mandatory for acceptable seals. Also, operator training and experience play an important part in reducing test failures.

The heat seal failure values of Table IV indicate that the 50 oz. test requirement is well below the ultimate strength of a seal produced at the proper temperature and pressure.

The tests performed by the Navy, Table V, indicate that the barrier material was of acceptable quality for heat sealing.

RECOMMENDATIONS

- 1. Heat sealers used in sealing MIL-B-131 materials should be on a strict preventative maintenance schedule.
- 2. Heat sealer operators should be knowledgeable of the machine and thoroughly trained.
- 3. Constant surveillance of the heat seals is necessary to insure high quality seals.
- 4. Experimentation with the heat seal machine is necessary to establish the proper operating temperatures and pressures.
- 5. Care should be exercised in quality control tests to clamp the samples in the test device perpendicular to the jaws such that the weight pulls uniformly across the heat seal area.
- 6. Variable dwell times for cooling/compression as well as heating are features to be desired for future procurements of heat sealers.

SAMPLING PATTERN



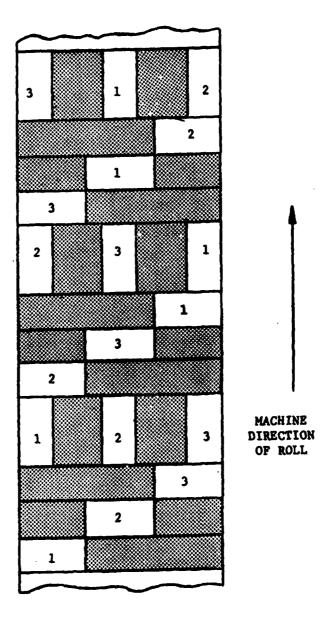


FIGURE 1

MODEL HS-B DOBOY CONTINUOUS HEAT SEALER

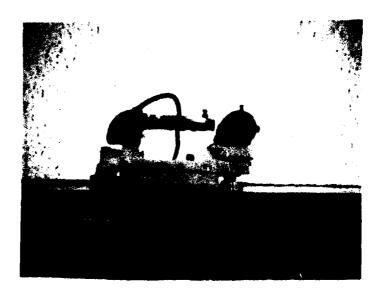


FRONT

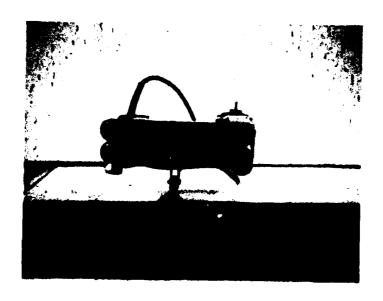


BOTTOM

FIGURE 2

MODEL 12-12ASC SENTINEL HEAT SEALER

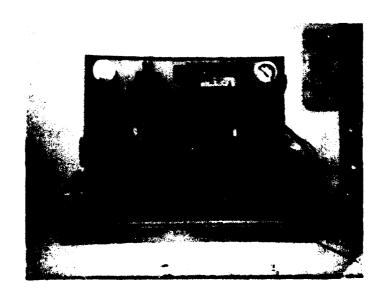

LAB-CHRON ELECTRIC TIMER

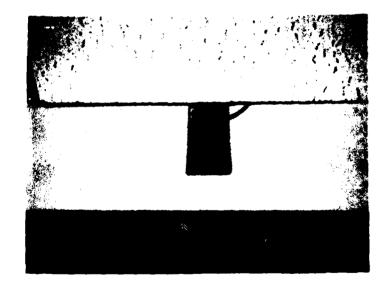

DEAD WEIGHT HEAT SEAL TEST FIXTURE WITH SAMPLE

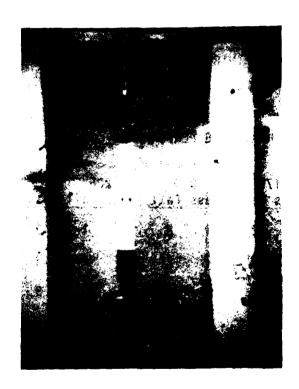


TABLE I - MIL-B-131 SAMPLE MATERIALS EVALUATED

Sample Identification Number	Lot #	ALC	Form
A	1	Warner Robins	Roll/Sheets
В	2	Sacramento	Roll/Sheets
С	1	Oklahoma City	Roll/Sheets
D	H3562	Ogden	Roll/Sheets
E	1	Ogden	Bags
F	1300	Ogden	Bags
G	2	Ogden	Roll/Sheets
Н	H1208	0gden	Roll/Sheets
I	H1201	Ogden	Bags
J	5	Ogden	Bags
K	H3054	Ogden	Bays
L	H1824	AFPEA	Roll/Sheets

TABLE II - TEMPERATURE VS HEAT SEAL PERFORMANCE

*Material						00 Fail								
В	1	2	1	2	1	2	2	1	3	0	3	0	3	0
c	1	2	1	2	1	2	1	2	3	0	3	0	3	0
D	2	1	0	3	0	3	3	0	3	0	2	1	3	0
E	2	1	0	3	0	3	3	0	3	0	3	0	3	0

^{*}NOTE: Total of 84 specimens evaluated

TABLE III - QUALITY CONTROL TESTS

*Material	Number Pass	Number Fail	Reject/ Accept
A	15	3	Reject
В	18	0	Accept
С	18	0	Accept
D	31	5	Reject
E	8	1	Accept
F	18	0	Accept
G	16	2	Accept
Н	16	2	Accept
I	18	0	Accept
J	7	2	Reject
К	8	1	Accept
D(retest- Doboy)	18	0	Accept
D(retest- Sentinel)	18	0	Accept
E(retest- Doboy)	17	1	Accept
E(retest- Sentinel)	6	0	Accept

*NOTE: Total of 249 specimens evaluated

TABLE IV - TEST TO FAILURE OF HEAT SEAL

<u>Material</u>	Failure Weight (oz)
E	106
E	133
D	96
D	116
С	132
С	147

NAVAL AIR DEVELOPMENT CENTER AIRCRAFT AND CREW SYSTEMS TECHNOLOGY DIRECTORATE WARMINSTER, PA 18974

6061 9 Sep 1982

EVALUATION OF MIL-B-131 MATERIALS SUBMITTED BY AIR FORCE BASES

All of the materials submitted were tested for room temperature seam strength (paragraph 4.6.2 of MIL-B-131) and found to be satisfactory:

Air Force Base	Material	Sealing Conditions	Results
McClellan	В	400 ⁰ F, 3-sec	Passed
Robins	A	400 ⁰ F, 3-sec	Passed
	M	350 ⁰ F, 3-sec	Passed
Tinker	С	350 ⁰ F, 3 sec	Passed

Table V - Mil-B-131 Room Temperature Test

DISTRIBUTION LIST

	COPIES		COPIES
HQ USAF/LETT Wash DC 20330	1	Aviation Supply Office Attn: TEP-A TEE]
DESC/DESC-T/SQR 1507 Wilmington Pike Dayton OH 45444	1	700 Robbins Ave. Philadelphia PA 19111	•
WR-ALC/DSP Robins AFB GA 31098	1	ADTC/SD3P Eglin AFB FL 32542	1
OC-ALC/DSP Tinker AFB OK 73145	1	OO-ALC/DSP Hill AFB UT 84406	1
SM-ALC/DSP McClellan AFB CA 95652	1	SA-ALC/DSP Kelly AFB TX 78241 DARCOM	1
AFALD/PT WPAFB OH 45433	1	Packaging, Storage & Container Center ATTN: SDSTO-T	
HQ AFLC/LOZPP WPAFB OH 45433	1	Tobyhanna PA 18466 AFALD/PTP Library	1
DTIC/TSR, Cameron Sta + DD Fm Alexandria VA 22314	50 12	WPAFB OH 45433 DLSIE/DRXMC-D	20
USA Natick Labs ATTN: DRDNA-EPS Natick MA 01760	1	US Army Logistics Management ATTN: Mr. M. Alley Fort Lee VA 23801	1
NAVSUPSYSCMD (SUP-0321A) Wash DC 20376 GSA	5	USA Armament Research & Development Command ATTN: DRDAR-TST-S Dover NJ 07801	1
Ofc of Engrg Mgmt Packaging Div. Wash DC 20406	1	AFPRO P.O. Box 92463 Los Angeles, CA 90009	1

SECURITY CLASSIFICATION OF THIS PAGE (When Date Entered)

REPORT DOCUMENTATION PA	READ INSTRUCTIONS BEFORE COMPLETING FORM			
PTPT Report No. 82-10	4/21 39	BEFORE COMPLETING FORM RECIPIENT'S CATALOG NUMBER		
. TITLE (and Subtitie)		5. TYPE OF REPORT & PERIOD COVERED		
nvestigation of MIL-B-131 Barrier Material eat Seals		Final		
		6. PERFORMING ORG. REPORT NUMBER AFPEA Project #81-P7-27		
AUTHOR(*) Ted P. Smith		B. CONTRACT OR GRANT NUMBER(*)		
Dwight S. Sheeter		N/A		
PERFORMING ORGANIZATION NAME AND ADDRESS		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS		
AFALD/PTPT WPAFB OH 45433		AREA W WORLD AND ADMIDERS		
CONTROLLING OFFICE NAME AND ADDRESS		12. REPORT DATE October 1982		
WPAFB OH 45433		13. NUMBER OF PAGES		
MONITORING AGENCY NAME & ADDRESS(If different from	om Controlling Office)	15. SECURITY CLASS. (of this report)		
		UNCLASSIFIED		
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE		
APPROVED FOR PUBLIC RELEASE DISTRIBUTION UNLIMITED				
. DISTRIBUTION STATEMENT (of the abstract entered in E	Block 20, II different fro	an Report)		
SUPPLEMENTARY NOTES				
KEY WORDS (Continue on reverse elde if necessary and id	. ,			
Barrter Material, Heat Seals, MIL-B-1	31, MIL-P-116			
ABSTRACT (Continue on reverse side if necessary and ide				
his study was performed to evaluate est specified in MIL-P-116 for MIL-B	the severity o -131 barrier m	f the 50 oz. dead aterial heat seal		

of the Air Logistics Centers were reporting a high incidence of heat seal rejections. The study indicated the current test requirement and procedure to be realistic and attainable provided that proper techniques for equipment cleaning and set-up are followed. Also careful attention to temperature and pressure settings is necessary.

DD 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

15